



Important!

Please give copies to all
your VW Technicians

Technical Bulletin

Subject: Door, Squeaking Noise in Latch/Lock Area


Group: 57

Number: 00-02

Model(s): New Beetle

1998 ► 2000

Date: June 7, 2000

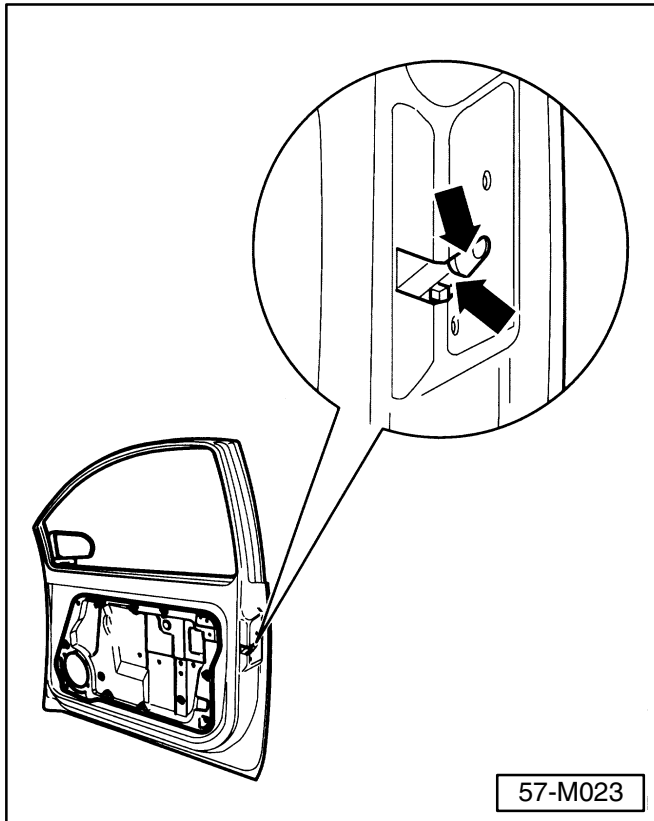

Condition

Squeaking noise in area of front door latch/lock area.

May be caused by lack of lubrication at door latch contact surface over time.

Service

Lubricate door locks as follows:

- Open doors.
- Thoroughly clean door locks with clean cloth.
- ◀ - Lubricate door locks at -arrows- using silicone spray Part No: D 007 000 A2 in short bursts.
- Close and open doors several times.
- Inspect sprayed areas -arrows- (they must be damp with silicone spray), reapply if necessary.

CAUTION!

Always read and follow directions on silicone spray container.

- Confirm noise has been eliminated.

Note:

Do not adjust the door for this condition because, this may introduce subsequent problems such as: wind noise, uneven gaps between door and body, poor fit of door etc.

C 57-00-02